



WEIGHING SCALES

- Zero-setting, weighing, subtracting tare value
- LCD display, with backlight
- Automatic power off
- Unit: kg, lb

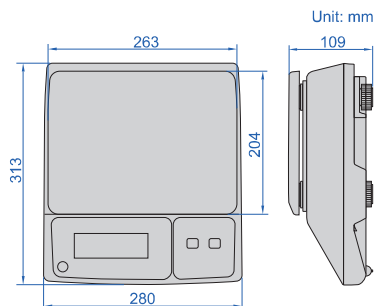

8001-6

checking alarm (for scales with tri-colour alarm light)

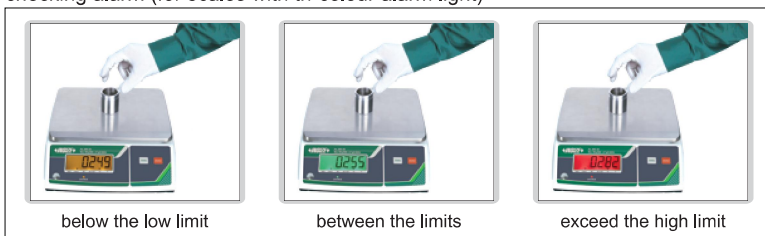

below the low limit

between the limits

exceed the high limit



printer (optional)

SPECIFICATION

Code	8001-6	8001-15	8001-30	8001-6D	8001-15D	8001-30D
Weighing capacity	6kg	15kg	30kg	6kg	15kg	30kg
Minimal load	4g	10g	20g	4g	10g	20g
Readability (d)	0.2g	0.5g	1g	0.2g	0.5g	1g
Repeatability	±0.4g	±0.5g	±1g	±0.4g	±0.5g	±1g
Linearity	±1g	±1.5g	±3g	±1g	±1.5g	±3g
Stabilization time	1.5s					
Dimension of pan	263×204mm					
Checking alarm	tri-colour alarm light			no		
Output	no			RS232		
Operation temperature	-10~40°C					
Operation humidity	≤85%RH					
Power supply	rechargeable lead acid battery (6V/3.2Ah)					
Dimension (L×W×H)	313×280×109mm					

OPTIONAL ACCESSORY (for scales with RS232)

Data output cable (keyboard format)	7302-8001
Wireless transmitter	7315-8001*
Printer	8391-PRN10

* Receivers are needed: code 7315-2/3/6/7/8/9