DIAL INDICATORS (STANDARD TYPE)

- Meet DIN878

7

- Jeweled bearing
- Supplied with limit pointers and bezel clamp
- Optional accessory: backs (page 114~115), contact points (page 111~113)




2308-10A

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Remark
2308-3FA*	3mm	0.01mm	12µm	3µm	1mm	0-100	flat back
2308-5FA*	5mm	0.01mm	14µm	3µm	1mm	0-100	flat back
2308-10FA*	10mm	0.01mm	17µm	3µm	1mm	0-100	flat back
2308-3A*	3mm	0.01mm	12µm	3µm	1mm	0-100	lug back
2308-5A*	5mm	0.01mm	14µm	3µm	1mm	0-100	lug back
2308-10A*	10mm	0.01mm	17µm	3µm	1mm	0-100	lug back

^{*}Supplied with manufacturer inspection certificate traceable to NIST USA





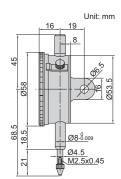

REVERSE READING DIAL INDICATORS

- Meet DIN878
- Suitable for depth and step measurements
- Jeweled bearing
- Supplied with limit pointers and bezel clamp
- Optional accessory: backs (page 114~115), contact points (page 111~113)




2801-10

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Remark
2801-10F *	10mm	0.01mm	17µm	3µm	1mm	100-0	flat back
2801-10*	10mm	0.01mm	17µm	3µm	1mm	100-0	lug back

^{*}Supplied with manufacturer inspection certificate traceable to NIST USA







SHOCKPROOF DIAL INDICATORS

- Meet DIN878
- Shockproof
- Jeweled bearing
- Supplied with limit pointers and bezel clamp
- Optional accessory: backs (page 114~115), contact points (page 111~113)



2314-10A

Code	Range	Graduation	Accuracy	Hysteresis	Range/rev	Dial reading	Remark
2314-3FA *	3mm	0.01mm	12µm	3µm	1mm	0-100	flat back
2314-5FA *	5mm	0.01mm	14µm	3µm	1mm	0-100	flat back
2314-10FA*	10mm	0.01mm	17µm	3µm	1mm	0-100	flat back
2314-3A*	3mm	0.01mm	12µm	3µm	1mm	0-100	lug back
2314-5A*	5mm	0.01mm	14µm	3µm	1mm	0-100	lug back
2314-10A *	10mm	0.01mm	17µm	3µm	1mm	0-100	lug back

^{*}Supplied with manufacturer inspection certificate traceable to NIST USA







